


AERODROME
CHART - ICAO

37°27'45"N
126°26'21"E

ELEV 7 m

TWR	118.2(E)	118.8(W)
GND	121.75(E)	121.7(W)
APRON	121.65	122.175
	121.8	123.325
		129.725

SEOUL / Incheon Intl

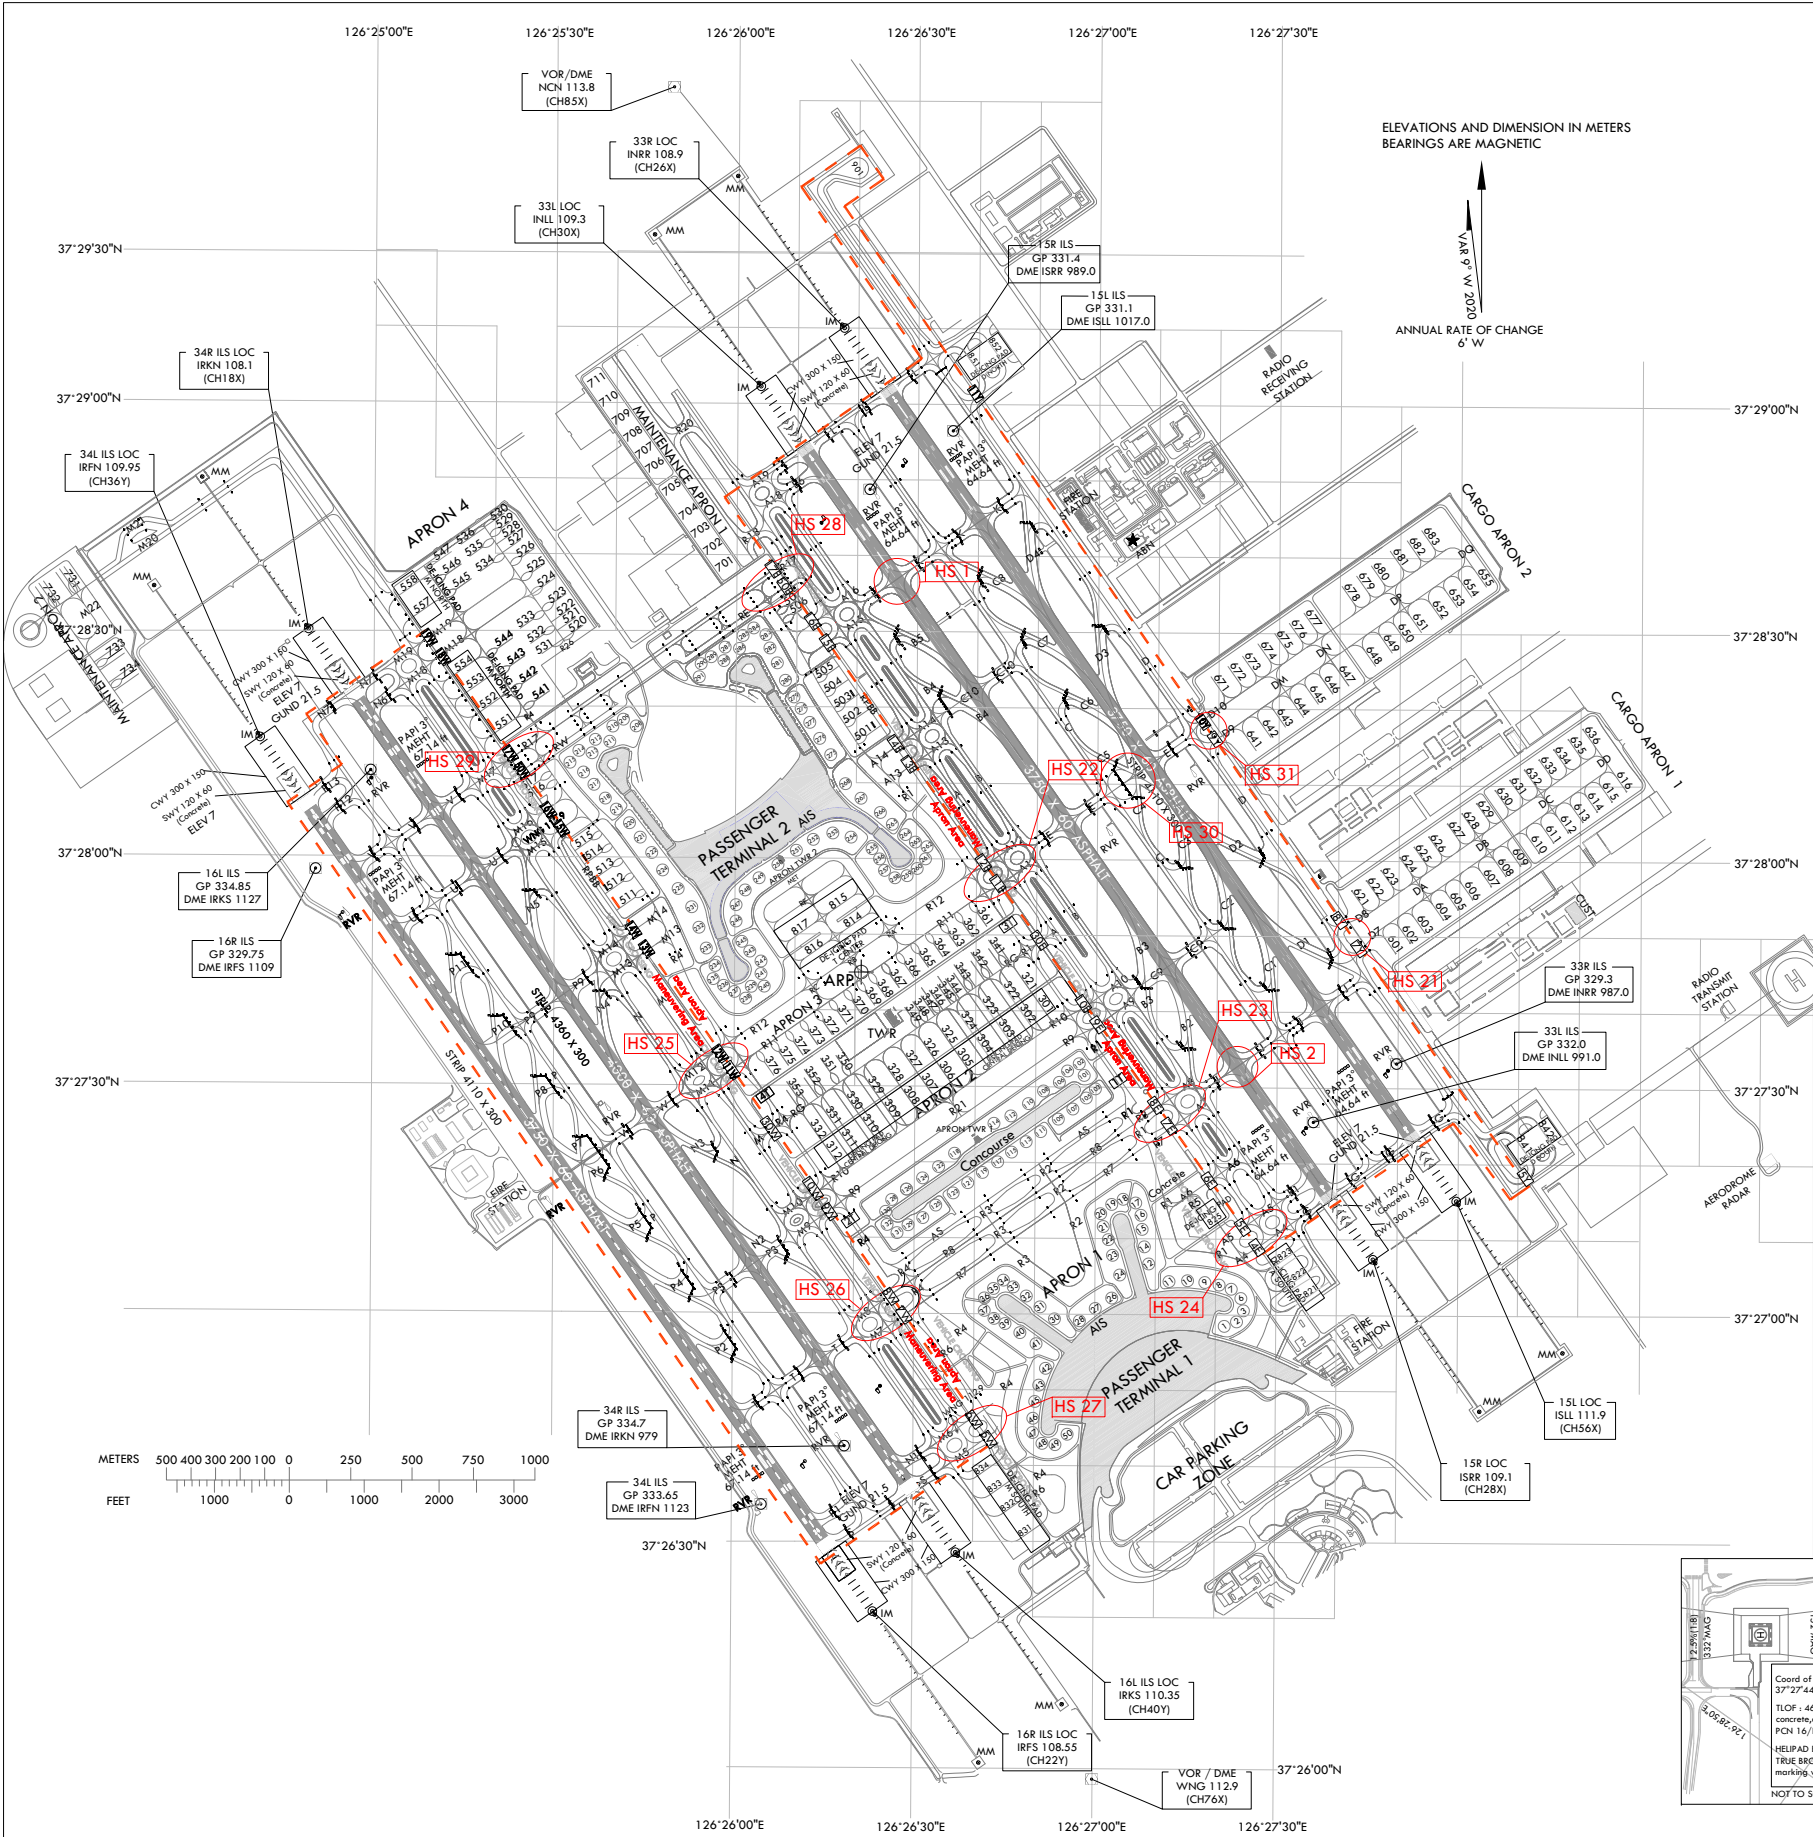

RWY	DIRECTION (MAGNETIC)	THR	BEARING STRENGTH
15R	153°	37°28'54"N 126°26'11"E	PCR 1 610/F/B/X/T Asphalt (SWY and 300 m RWY ends are 1 300/R/B/X/T Concrete)
33L	333°	37°27'15"N 126°27'39"E	
15L	153°	37°29'02"N 126°26'25"E	PCR 1 610/F/B/X/T Asphalt (SWY and 300 m RWY ends are 1 300/R/B/X/T Concrete)
33R	333°	37°27'23"N 126°27'53"E	
16L	153°	37°28'22"N 126°24'56"E	PCR 1 290/F/B/X/T Asphalt (SWY and 700 m RWY ends are 1 160/R/B/X/T Concrete)
34R	333°	37°26'36"N 126°26'30"E	
16R	153°	37°28'08"N 126°24'48"E	PCR 1 370/F/B/X/T Asphalt (SWY and 842 m RWY ends are 1 510/R/B/X/T Concrete)
34L	333°	37°26'28"N 126°26'16"E	

TAXIWAY A, D 30 m WIDE CONCRETE PCR 1 300/R/B/X/T
TAXIWAY B, C 30 m WIDE ASPHALT PCR 1 610/F/B/X/T
TAXIWAY M 30 m WIDE CONCRETE PCR 1 160/R/B/X/T
TAXIWAY N 30 m WIDE ASPHALT PCR 1 290/F/B/X/T
TAXIWAY P 30 m WIDE ASPHALT PCR 1 370/F/B/X/T
PAX Terminal and Concourse A VDGs equipped


HS 1	AIRCRAFT TAXIING ON TAXIWAY K FROM RUNWAY 33R AFTER LANDING USE CAUTION WHEN ATC UTILIZES RUNWAY 33L FOR TAKEOFFS. DO NOT CROSS THE HOLDING MARKING FOR RUNWAY 33L WITHOUT ATC AUTHORIZATION.
HS 2	AIRCRAFT TAXIING ON TAXIWAY J FROM RUNWAY 15L AFTER LANDING USE CAUTION WHEN ATC UTILIZES RUNWAY 15R FOR TAKEOFFS. DO NOT CROSS THE HOLDING MARKING FOR RUNWAY 15R WITHOUT ATC AUTHORIZATION.
HS 21 ~ 23, 25, 26	USE CAUTION OF CONFUSION ON TAXIWAYS. DO NOT PROCEED TAXIING BEYOND TRANSFER OF CONTROL POINTS WITHOUT CLEARANCE FROM INCHEON APRON OR GROUND(TOWER).
HS 24, 27	USE CAUTION OF CONFUSION ON TAXIWAYS. DO NOT PROCEED TAXIING BEYOND TRANSFER OF CONTROL POINTS WITHOUT CLEARANCE FROM INCHEON APRON OR GROUND(TOWER). AND DO NOT MOVE WHEN SAFETY DISTANCE IS NOT ASSURED.
HS 28, 29	USE CAUTION OF CONFUSION OF TAXIWAYS. TAXILANE RW & RE ARE NOT COMPLIANT WITH CODE D, E, F AIRCRAFT. USE CAUTION OF VEHICLE AROUND GSE ROADS INTERSECTION AREAS(RE-R1, RW-R4).
HS 30	AIRCRAFT VACATING ON RUNWAY 33R/15L TO TAXIWAY C AFTER LANDING USE CAUTION C4, C5 NOT AVAILABLE WHEN AIRCRAFT ON TAXIWAY C-E.
HS 31	USE CAUTION OF CONFUSION ON TAXIWAYS. DO NOT PROCEED TAXIING BEYOND TRANSFER OF CONTROL POINTS WITHOUT CLEARANCE FROM INCHEON APRON OR GROUND(TOWER).

LEGEND	
	VOR check-point and frequency
	Stop-bar light
	Runway holding position
	Taxi lane
	Gate
	Remote stand
	Open channel
	ATC service boundary (Maneuvering area)
	Transfer of control point (TCP)
	Hot spot
	Remote Passenger Boarding Bridge (501, 503, 512, 514)

Note
Aircraft shall not taxi into maneuvering area without clearance from Incheon Tower or Ground.

Change : Establishment of maintenance apron 2 and Information of de-icing pad(ACFT stand NR. 558), TWYs.

MARKING AIDS RWY 15R/33L, 15L/33R, 16L/34R, 16R/34L AND EXIT TWY

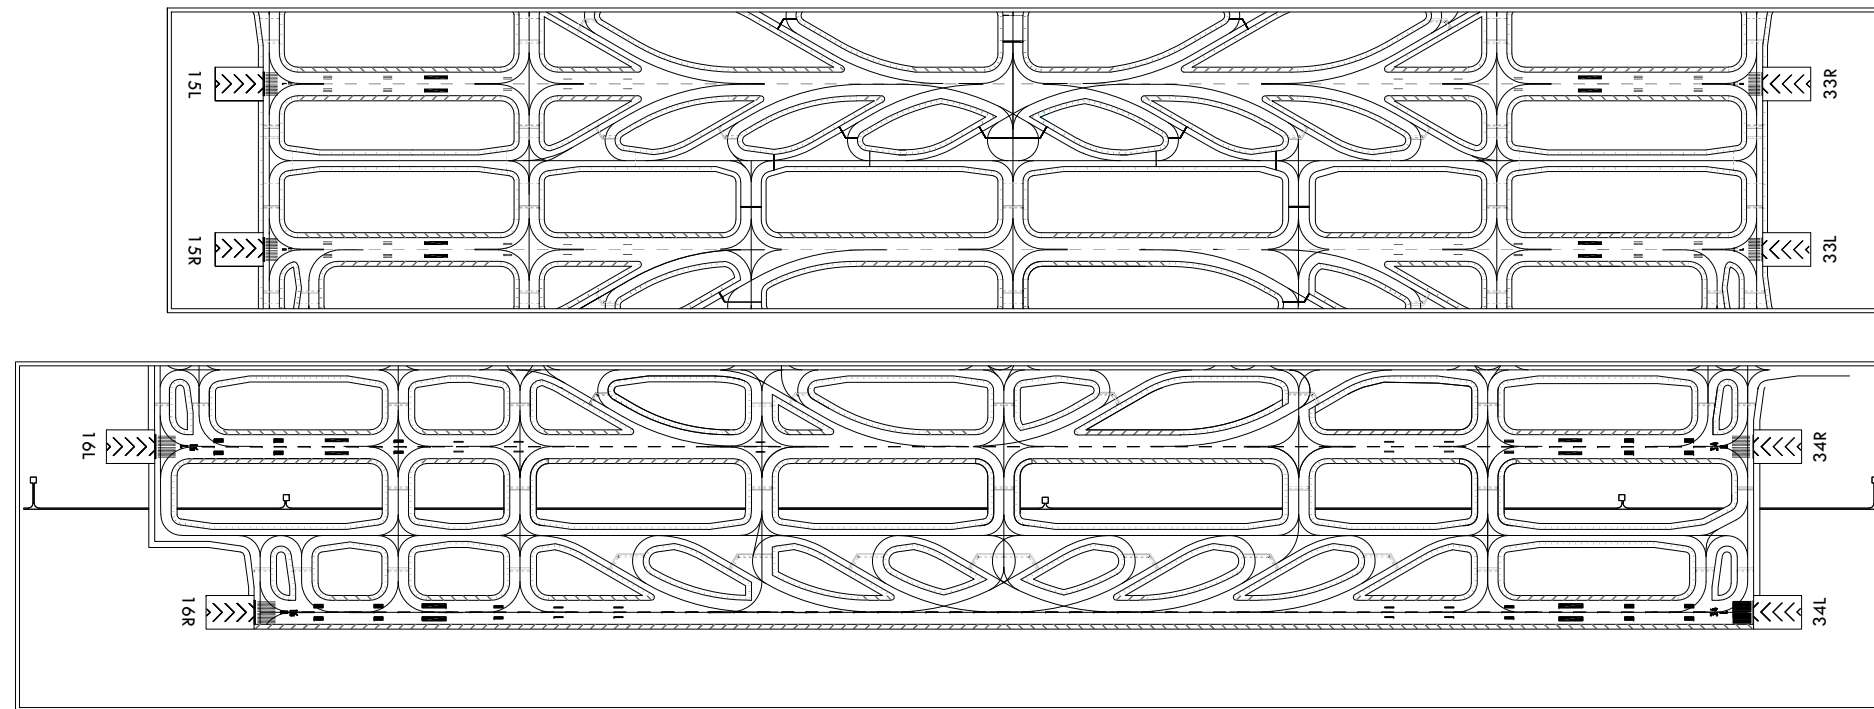

LIGHTING AIDS RWY 15R/33L, 15L/33R, 16L/34R, 16R/34L AND EXIT TWY

